





Edition :	Page
SERIE :	/
PEN :	

TITRE : SIZE 1 PIN COAX WIRING INSTRUCTIONS FOR UT 141 CABLE

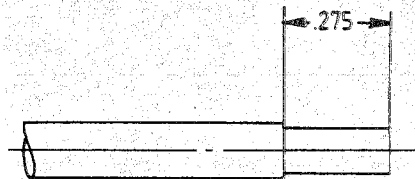


**STEP 1**

STRIP THE CABLE AT DIMENSION SHOWN

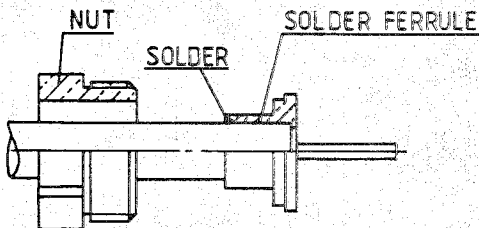


**STEP 2**

SLIDE THE NUT OVER THE CABLE  
INTRODUCE THE SOLDER FERRULE ON THE DIELECTRIC UNTIL BUTTING ON THE CABLE  
SOLDER THE FERRULE WITH A 250W MAX TOOL  
THEN TRIM DIELECTRIC

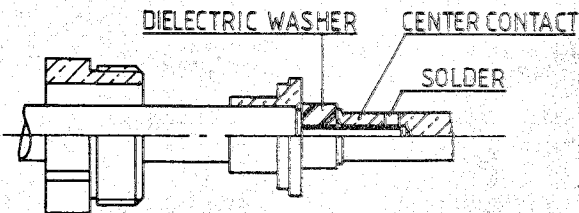

**STEP 3**

SLIDE DIELECTRIC WASHER ON THE CENTER CONDUCTOR. THEN CENTER CONTACT  
SOLDER THE CENTER CONTACT WITH A 250W MAX TOOL

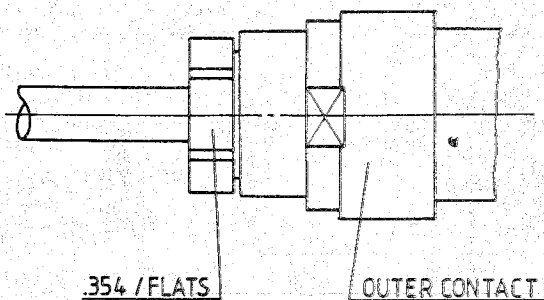

**STEP 4**

INTRODUCE THE CABLE ASSEMBLY INTO THE OUTER CONTACT SCREW AND TIGHTEN THE NUT


IND	MODIFICATIONS	DATE	VISA

Création Date 2.20.90  
 Mise à jour Date \_\_\_\_\_

Ces renseignements vous sont donnés à titre indicatif. Dans le but constant d'améliorer nos produits, nous nous réservons le droit d'apporter toutes modifications jugées utiles.



101, Rue Philibert Hoffmann - Z.I. Ouest  
 93116 ROSNY/S/BOIS Cedex (France)  
 Tél. : (1) 48 54 80 43 - Fax 88 : (1) 48 35 35 28  
 Fax : (1) 48 54 93 63  
 Télex : RADIA 239220